

VEHICLE SERVICES LTD

15 Cebalo Place, Mt Wellington • phone (09) 525 2230
 Mobile 021 623 855 • laurie@ihug.co.nz • GST 91-707-152
 NZTA # 354576-155

PRE-PURCHASE CHECK

6122

Inspected by Mark

NAME: Fred Citizen CONTACT: 555 1234 DATE: 8/7/10

VEHICLE: Honda Accord MILEAGE: 213614kms REG. NO. ABC 123 VIN. NO. 123456789


ABBREVIATIONS USED: SATISFACTORY AT TIME OF INSPECTION DEFECT NEEDS ATTENTION 0 SOME WEAR & TEAR APPARENT KEEP UNDER OBSERVATION N/A NOT APPLICABLE

- ENGINE CONDITION**
1. Compression Balance
 2. Pistons & Rings
 3. Head Gasket
 4. Timing Chain
 5. Cam Followers
 6. Oil Leaks
 7. Oil Level
 8. Oil Condition
 9. Piston Blowby
 10. Bearings
 11. Cambelt - See note ②
- ELECTRONIC**
12. Spark Plugs
 13. Distributor
 14. Coil
 15. H.T Leads
 16. Carburetion
- ENGINE ELECTRICAL SYSTEM**
17. Battery
 18. Connections
 19. Wiring
 20. Charging System
 21. Starter Motor
 22. Starter Solenoid
- COOLING SYSTEM**
23. Radiator
 24. Radiator Cap
 25. Water Hoses
 26. Drive Belt(s)
 27. Thermostat
 28. Water Pump
 29. Frost Plugs
- VEHICLE ELECTRICAL SYSTEM**
30. Gauges

31. Side Lights
 32. Stop Lights
 33. Electrical Switches
 34. Radio / Band Expander
 35. Aerial
 36. Horn
 37. Heater Fan
 38. Heater
 39. Air Conditioning
 40. Screen Washers
 41. Wipers
 42. Indicators
 43. Head Lights
 44. Number Plate Light
 45. Hazard Lights
- EXHAUST SYSTEM**
46. Mufflers
 47. Pipes
 48. Brackets / Clamps
 49. Manifold Gasket
 50. Flange Gasket
 51. Standard System
- FRONT SUSPENSION**
52. Shock Absorbers
 53. Springs
 54. Suspension Units / Mounts
 55. Bushes
 56. Anti Roll Bar
 57. Torsion Bar
- STEERING**
58. Steering Wheel
 59. Linkages / Joints
 60. Steering Box
 61. Rack & Pinion
 62. Steering Arms
 63. Left Wheel Bearings
 64. Right Wheel Bearings
 65. Rubber Boots

66. Wheel Alignment
 67. Wheel Balance
 68. Power Steer Pump + Hoses
- REAR SUSPENSION**
69. Springs
 70. Mounts
 71. Shock Absorbers
 72. Control Arms
 73. Bushes
 74. Wheel Bearings
 75. CV Boots
- DRIVE SHAFT & JOINTS**
76. Front Universal
 77. Centre Universal
 78. Rear Universal
 79. Left CV Joint and Boots
 80. Right CV Joint and Boots
- UNDER BODY**
81. Sub Frame / Mountings
 82. Hoses & Pipes
 83. Cables & Wires
 84. Tread Depth (3) LF
 85. Tread Depth (3) RF
 86. Tread Depth (4) LR
 87. Tread Depth (4) RR
 88. Tread Depth () SP
 89. Condition
 90. Wheel / Rims
- BRAKES**
91. Operation
 92. Hydraulics Master Cyl
 93. Hydraulics Slave Cyl
 94. Hydraulics Pipes / Hoses
 95. Discs / Pads Where Visible
 96. Brake Booster

97. Park Brake
 98. Brake Fluid Level
- ROAD TEST**
99. Brakes
 100. Performance
 101. General Handling
 102. Clutch
 103. Gearbox
 104. Auto Transmission
 105. Differential
 106. WOF Not Exceeding 1 Month Registration Current
- EXTERNAL BODY & TRIM**
108. Bumpers
 109. Trim & Chrome
 110. Mirrors
 111. Knobs & Handles
 112. Doors
 113. Light Lenses & Reflectors
 114. Fuel Tank Cap
 115. Badges
- INTERNAL BODY & TRIM**
116. Water Leaks
 117. Rubbers & Seals
 118. Mirrors
 119. Interior Trim
 120. Upholstery
 121. Carpet
 122. Knobs & Handles
 123. Doors / Windows
 124. Courtesy Light
 125. Jack Wheel Brace etc
 126. Bonnet Release
 127. Boot Release
 128. Seats
 129. Seat Belts Front Visual
 130. Seat Belts Rear Visual
 131. Hydraulic Struts

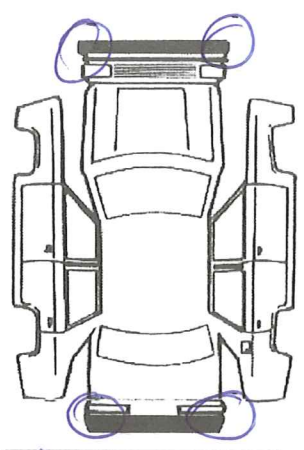

132. Accident Damage / Windscreen Repair
- BODY PANELS**
133. Surface Rust
 134. Scratches
 135. Paint Deterioration
 136. Dents
 137. Panel Alignment
- SERVICE NEEDED**
138. Oil Change & Filter / Air Filter
 139. Tune Up
 140. Recommend Full Service
- REPORT**
- GOOD (Vehicle in sound condition)
- AVERAGE (Some defects but in keeping with age and mileage)
- FAIR (Below average condition and requires attention)
- POOR (Vehicle unsafe to drive in present condition)

No.	COMMENTS	No.	COMMENTS
11	Cambelt - no history - see note ② in doubt - replace	111	WOF Expiry 17/9/10
8	Engine sludgy + oil dirty	112	Rego Expiry 23/1/11
17	Test showed weak battery -> replace		RUC Milage N/A
28	pressure test showed waterpump leak		Notes:
39	air conditioning not working		Auto Trans. flush etc - \$250
61	oil leak from steering rack		Trailing arm bushes - \$360
73	Both rear trailing arm bushes cracked		Battery - \$120
95	Front brake pads low - replace soon		* All plus GST
88	spare wheel not bolted down		
104	Auto Trans. oil dirty		
134	scuffs on corners of both bumpers		
120	wear + splits on drivers seat		
132	possible accident damage to left front panel fit not good		
			③ Recommend full service
			④ Drives OK

INSPECTION FEE: NZ\$ 140 - 00
 (includes GST)

I understand everything the Inspector explained to me.

SIGNATURE Fred Citizen

Report is based on external examination only and whilst every effort is made to ensure accuracy, Vehicle Services Ltd cannot be responsible for any omissions or any fault that might occur after the inspection. Vehicle road tested to maximum speed of 50 Kph.

PRINT NAME: Fred Citizen